

Navajo Abandoned Uranium Mine

Site Screen Report

This form is for use at the site of abandoned uranium mines (AUM) located on Navajo Nation lands. Applicable sites include all mine and mine features that have or have not undergone reclamation by the Navajo Abandoned Mine Lands Reclamation Program, including features, adits, pits and waste piles. Applicable sites also include all AUM sites listed in the USEPA CERCLIS database, all sites listed in the 2008 AUM GIS Report issued by USACOE and USEPA, all AUM sites on allotment lands associated with the Navajo Nation, and any and all AUM sites not listed in any database located on Navajo lands. Reconnaissance of any sites located on lands adjacent to Navajo lands that may be impacting Navajo lands will need to be coordinated with the authorities appropriate to those lands.

The purpose of the form is to ascertain the status and location of the identified AUM site, and record all immediate site information associated with the mine site. Decisions and recommendations on what additional steps are needed will be provided on a separate document.

Mesa III, Northwest Mine AUM Site

Navajo AUM Northern Region

Prepared by:

Weston Solutions, Inc.

Contract: W91238-06-F-0083

12767.063.496.1111

March 2010

Part I Site Identification, Location and Status**Site Names and ID numbers as applicable****Mine ID:** 424**Map ID:** N233**CERCLIS:** NNN000908888**Navajo Abandoned Mine Land Reclamation Program:** None**Local name / Aliases:** Mesa 3, Northwest Mine**Chapter and local area:** Cove Chapter**County:** Apache**State:** Arizona**Lat/Long:** 36.5195447407 N / -109.247797915 W**Nearby road and highway:** Indian Route 33**Local Post Office:** Cove, AZ**Surface Land Status: check one or more and provide ownership and contact information below****Tribal Trust Land**☒**Private**☐**Bureau of Land Mgmt**☐**State**☐**Public lands**☐**Tribal Fee Land**☐**Allotment**☐**Fee land**☐**Subsurface Mineral Rights:**

No information on subsurface mineral rights ownership was found in the EPA/AUM Database.

Claim and operator information:

The mine site surface land status is classified as Tribal Trust Land. Historical documents showed the operator of the mine as Vanadium Corp. of America in 1966. No other historical ownership / lease information was identified in the EPA/AUM database.

Number of residential structures within 200 feet of mine:

None

Estimated volume of mine waste onsite:56 yd³

Part II Summary of radiological readings

Highest gamma radiation measurement:

263,656 counts per minute (cpm)

Describe any other radiological measurements:

A total of 2,126 gamma radiation measurements were collected from the mine site, ranging from 6,799 cpm to 263,656 cpm. Measurements at the top of the waste debris pile were found at levels above 200,000 cpm, and down gradient from the pile at 35,000 cpm. The measurements are represented in Figures 1 and 2.

Background Locations

#1 8,823 cpm


#2 8,982 cpm

#3 9,123 cpm

Average background = 8,976 cpm

Distribution Chart and Statistics:

The following chart and statistics were generated by ESRI ArcGIS 9.3.1, and show the general distribution of the site gamma radiation measurements. The horizontal X axis represents the gamma radiation reading levels in cpm (lowest levels to the left). The vertical Y axis represents the frequency of each gamma radiation level.

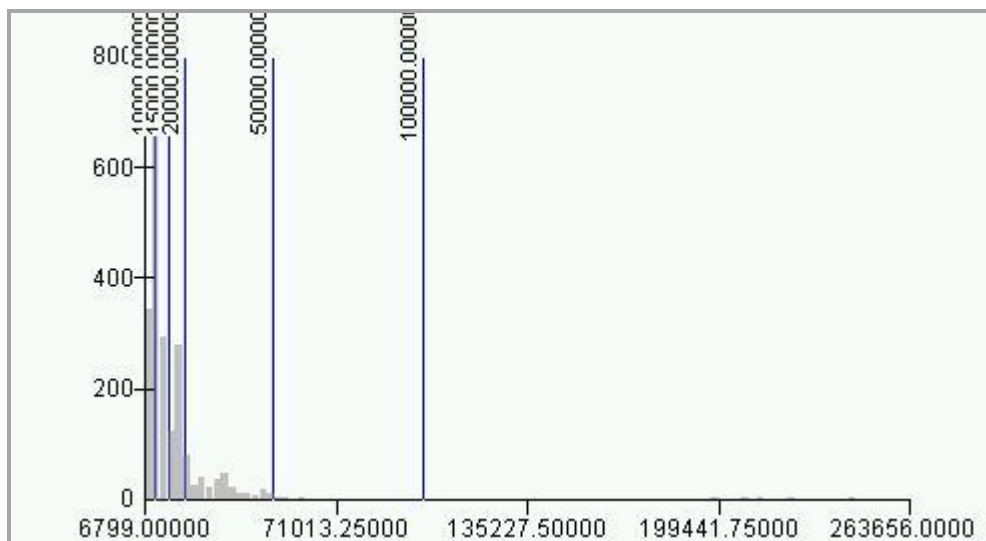

Count:	2126
Minimum:	6799.00000
Maximum:	263656.00000
Sum:	38435816.00000
Mean:	18078.93509
Median:	11970.50000
Standard Deviation:	24418.33696

Part III Status of Reclamation and Mine Waste

The following information was obtained from the Navajo Abandoned Mine Land Reclamation Program (NAMLRP) Point Features Database:

NAMLRP Status of the mine site: Reclaimed : No Waste Pile onsite : Yes

NAMLRP Project Number: None

NAMLRP Mine features: 1 Portal

The following information was obtained from field observations collected during the 2009 site screening:

Provide description and status of all mine sites and features at site. Include all waste piles, adits, pits and other features, and indicate whether they are open, closed, covered, capped, buried or unreclaimed. Indicate approximate size, shape and extent, including description of any reclamation caps. Note condition of all caps.

Observed reclamation work and status:**Adits**

None

Waste Piles

Fine waste pile, 10' x 30', with a total estimated volume of 56 yd³

Pits

None

Shafts

None

Other Debris and Mine Features

Wooden beam remnants, drainage pipe, mining debris extends through vegetation down steep decline

Part IV

Site observations and Environs

Observed Structures: list number of and describe human habitation status of structures at the following distances from mine:

0 to 200 feet: None

200 feet to 0.25 mile: An unoccupied house was located at the top of the mesa, approximately 0.25 miles southeast of the site.

Observed Public or commercial structure: list and describe all schools, clinics, Chapter Houses, places of business and any other structure used by members of the community at the following distances:

0 to 200 feet: None

200 feet to 0.25 mile: None

Levels measured around the perimeter(s) of the identified structure(s):

All gamma radiation measurements collected in the vicinity of the house were less than 11,000 cpm.

Observed water sources: list the number and type of wells and surface water sources that are potentially used for human consumption at the following distances from the mine:

0 to 0.25 miles: None

0.25 miles to 4 miles: None

Sensitive environments: note and describe all sensitive environments located within visible range of the mine site, including: wetlands, endangered species, habitats and approximate locations of sites that may be under protection of the government of the Navajo Nation.

None observed

Known Site History: include information from interviews with Chapter officials and residents. Note information on mine ownership, type of mining operation, period of operation, known amount of production, and any other information as provided.

Mesa III, Northwest Mine consists of an area of 29,381.49 m². The mine was identified as being operational in 1957. Historical documents showed the operator of the mine as Vanadium Corp. of America in 1966. While operational, the mine had a total reported production volume of 132 tons. No other historical information or any additional ownership / lease information was identified in the EPA/AUM database.

Part V Response Action Summary

Site Name(s): Mesa III, Northwest Mine **Chapter:** Cove

Decision Criteria

Is there an unreclaimed waste pile at the site? Yes

At what distance from the waste pile is the nearest residential structure located? 0.25 mi

At what distances from the waste pile are there potential drinking water sources? None

Is there a reclamation cap or sealed adit in place at the site? None

Is the cap/seal functionally intact? None

Is the cap/seal sufficiently degraded to create a concern about releases? No

At what distance from the cap/seal is the nearest domestic structure located? None

At what distance from the cap/seal is the nearest domestic drinking water source? None

Summary of emergency response factors

None

Summary hazard ranking system factors

None

Summary of reclamation factors

Unreclaimed waste pile

Part VI Photos



Photo 1. Waste rock



Photo 2. Mine site incline



Photo 3. Mining debris



Photo 4. House 0.25 miles southeast of site



Photo 5. Inside unoccupied house

Part VII Contacts Reports and InformationName: Stanley Edison (928) 871-6861Eugene Esplain (928) 871-7331Title or official role (if any) Navajo EPA Superfund ProgramAddress PO Box 2946, Window Rock, AZ 86515Information provided Lead Regulatory Agency

Name _____

Title or official role (if any) _____

Address _____

Telephone number _____

Information provided _____

Name _____

Title or official role (if any) _____

Telephone number _____

Information provided _____


Name _____

Title or official role (if any) _____

Telephone number _____

Information provided _____

**Figure 1 - Gamma Radiation Measurements, Above Two Times Background
Mesa III Northwest (424)
Cove Chapter, Navajo Nation, Arizona**

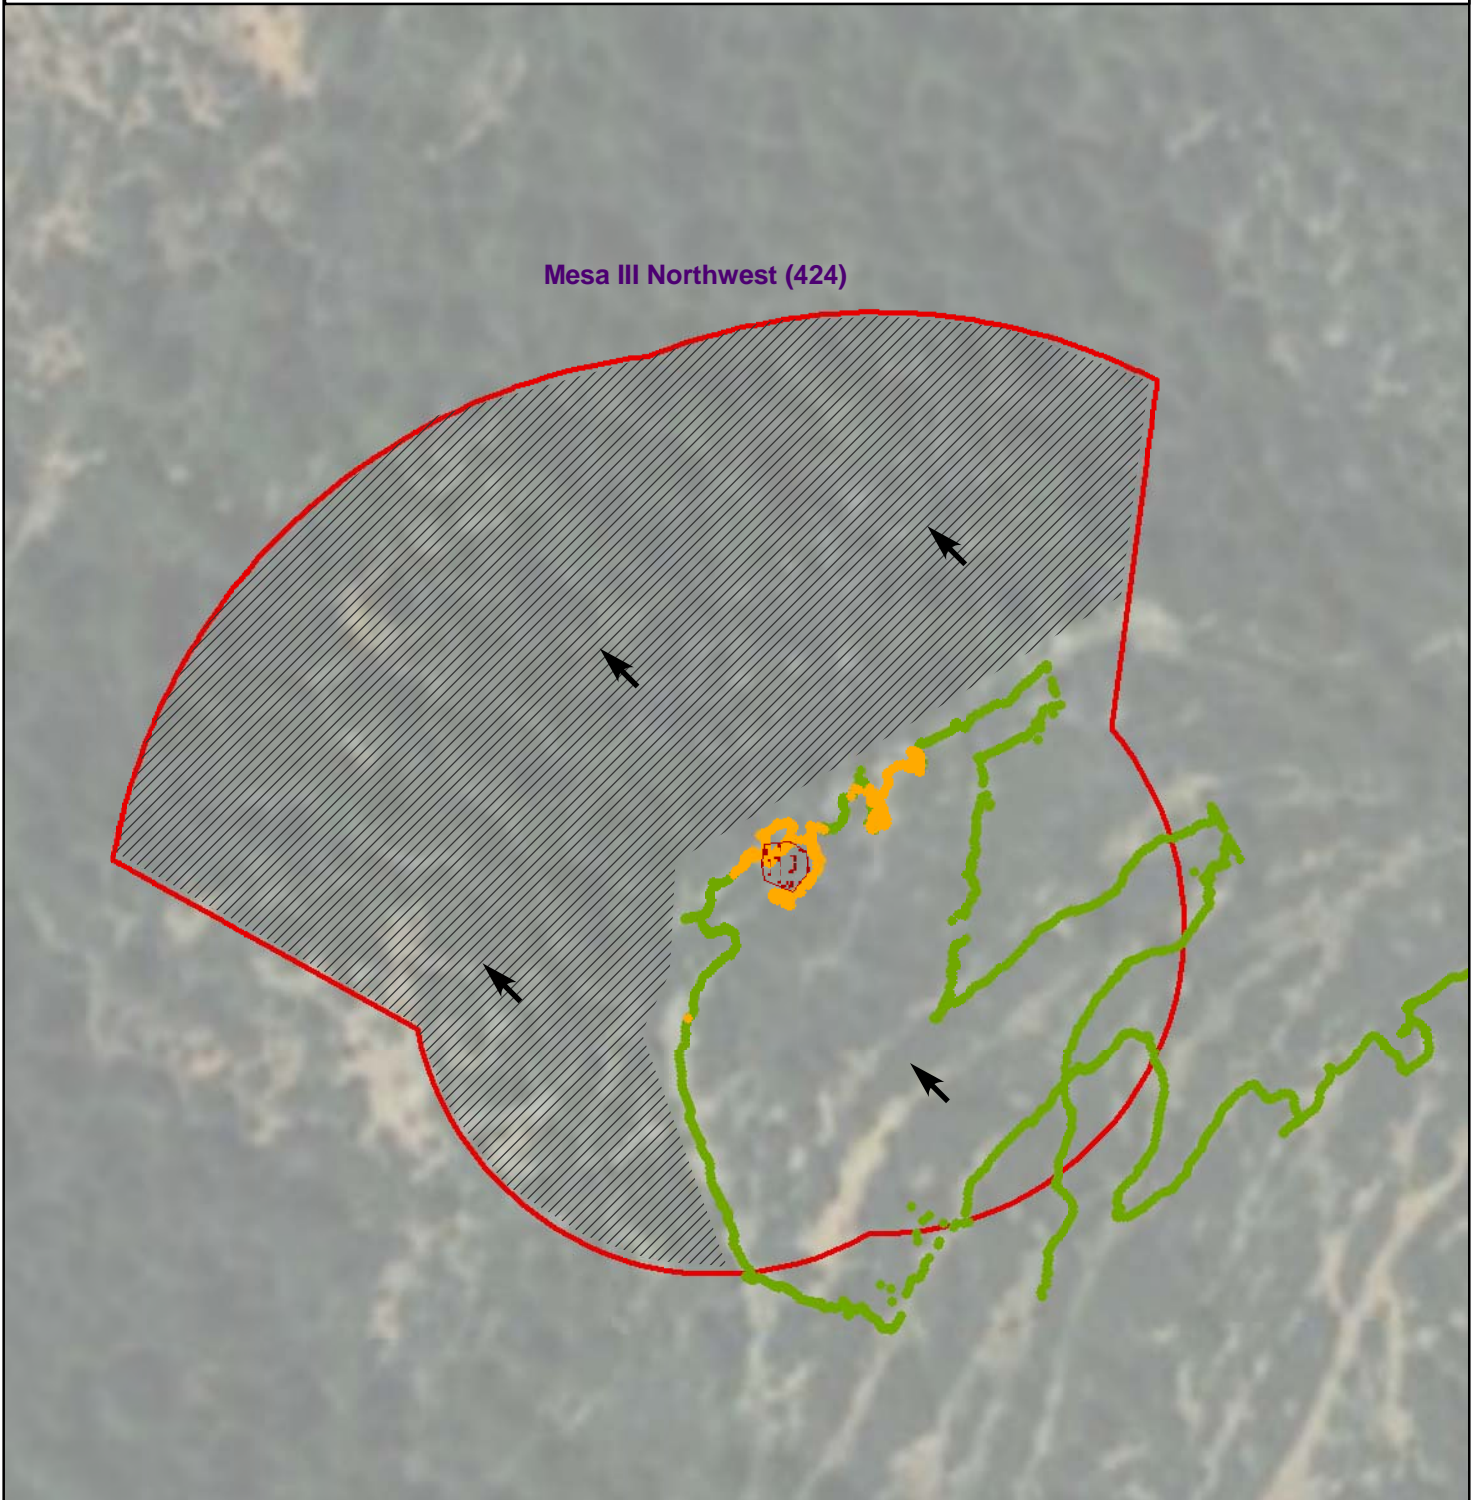

Legend

Gamma Radiation Measurements

- < 2X Background
- > 2X Background

Gamma survey conducted 10/2009
Measured as counts per minute (cpm)

Average background = 8,976 cpm



Observed Waste Pile



Inaccessible due to steep grades



General Direction Down-Slope



Mine Claim Boundaries




0 150 Feet



WESTON
SOLUTIONS

**Figure 2 - Gamma Radiation Measurements
Mesa III Northwest (424)
Cove Chapter, Navajo Nation, Arizona**

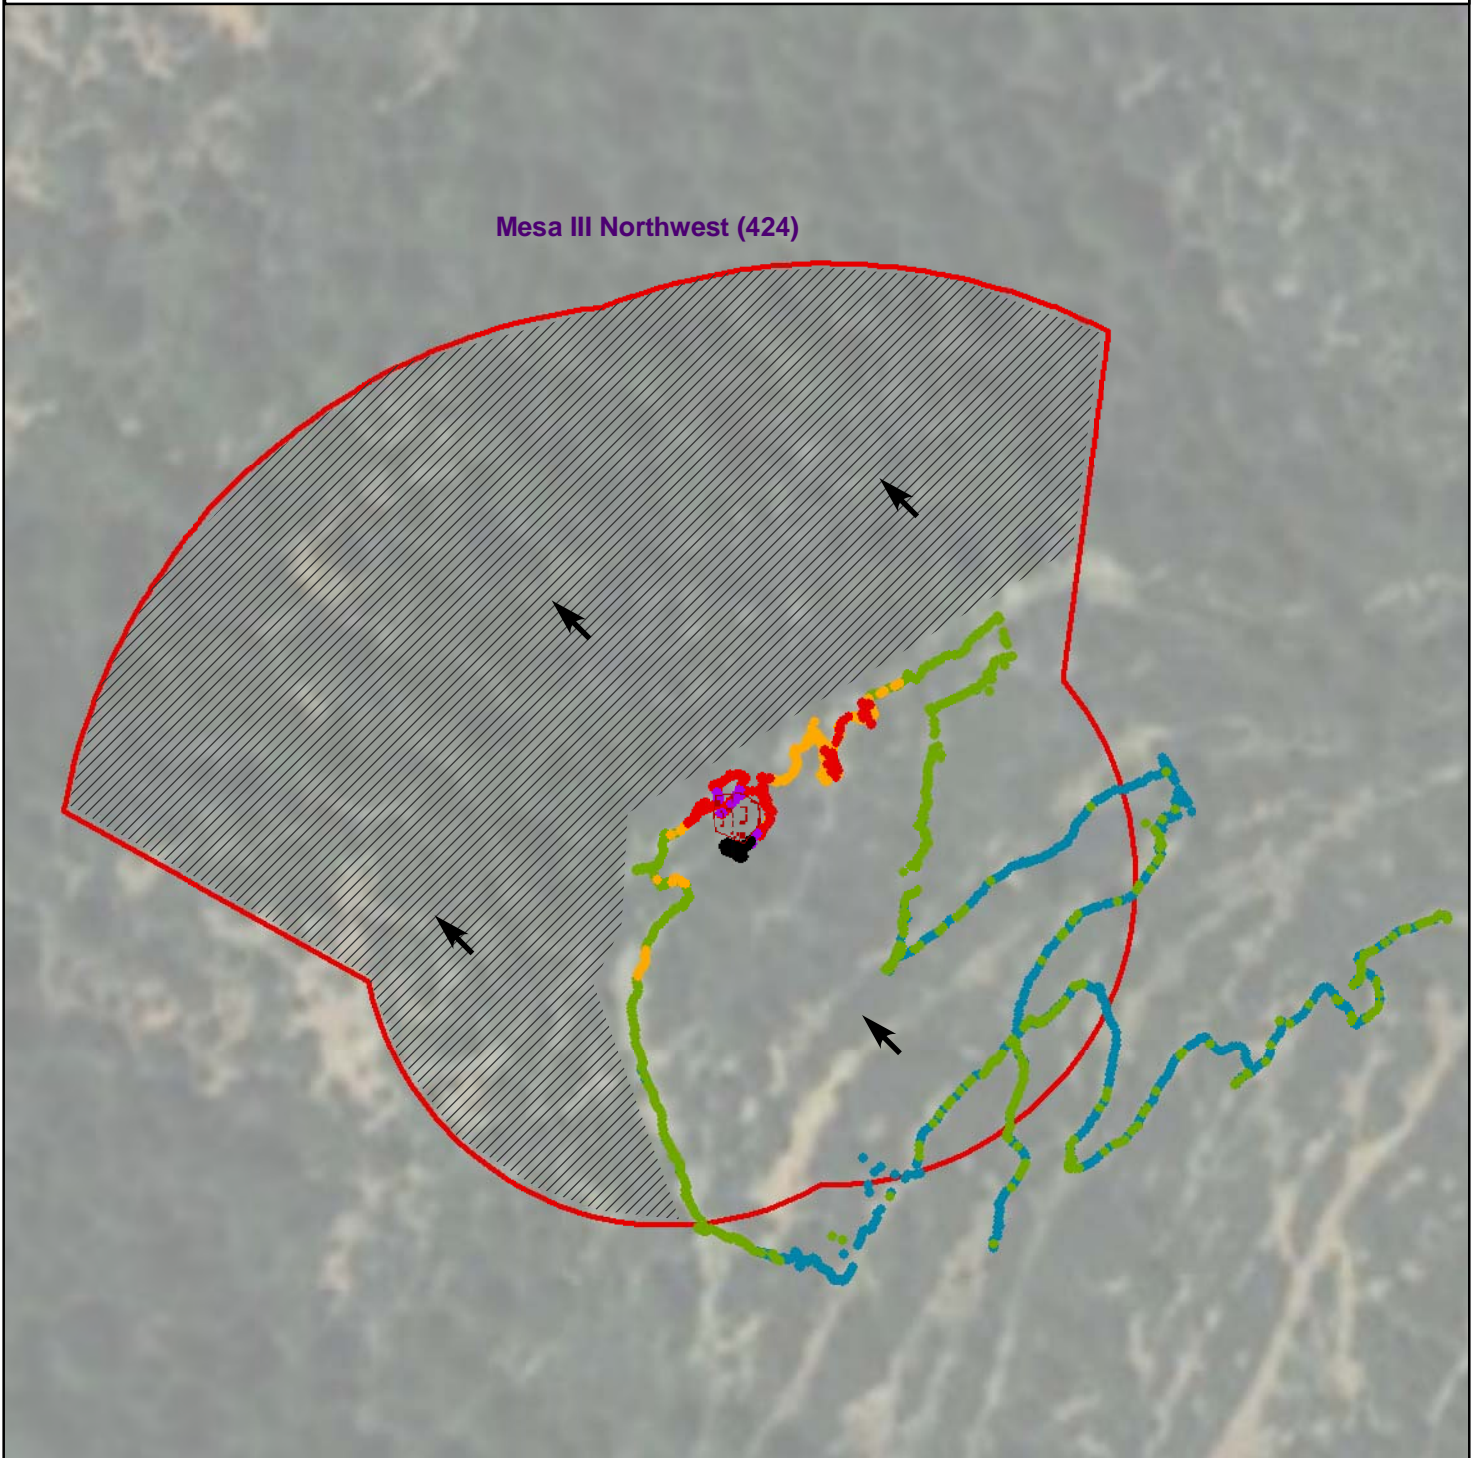

Legend

Gamma Radiation Measurements

- 0 - 10,000
- 10,000 - 15,000
- 15,000 - 20,000
- 20,000 - 50,000
- 50,000 - 100,000
- > 100,000



Observed Waste Pile



Inaccessible due to steep grades



General Direction Down-Slope



Mine Claim Boundaries

**Gamma survey conducted 10/2009
Measured as counts per minute (cpm)**

Average background = 8,976 cpm



0 150 Feet



WESTON SOLUTIONS